
### 2. 各部の名称と設定

### 2. Parts Names and Settings

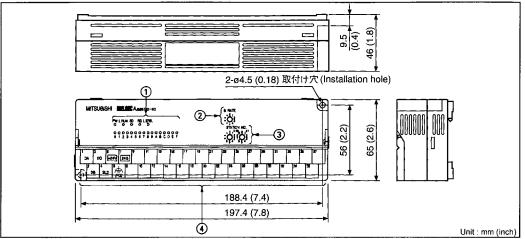

No. Item

No.	名称	内 容				
1	動作表示	LED名	確認内容			
	LED	PW	入力ユニ	ット電源 ON により点灯		
		LRUN 入力ユニットがマスタ局と正常にデータ 交信しているかチェックする。 マスタ局から正常なデータを受信すると き点灯、タイムオーバにより消灯する。 (正常なデータを受信することにより点灯する)				
j		SD	データき	信により点灯		
ĺ		RD	受信デー	タにより点灯		
		L ERR.	伝送エラ	ー(CRC エラー)により点灯、		
		タイムオーバにより消灯する。(RU				
		消灯〉				
			€、伝送速度設定ミスにより点灯			
		(設定を修正し電源再投入により消灯)局				
		番設定、伝送速度設定が途中で変化した				
		ときERR点滅(RUNは点灯、ユニットは				
			電源立上	: げ時の局番設定および伝送速度		
		設定の第		件で動作する)		
	ļ					
	[	0~F 入出力の		ON/OFF 状態を表示		
		1		で点灯、OFF 状態で消灯		
2	伝送速度		設定	伝送速度		
	設定	l	0	156 kbps		
			1	625 kbps		
			2	2.5 Mbps		
			3	5 Mbps		
		4		10 Mbps		
		伝送速度設定スイッチは必ず0~4の範囲で設定してください。				
3	局番設定	リモー	トルクユニ	ットの局番は、必ず01~64の範		
	スイッチ	囲で設定してください。(*1)				
		・"X10" は、局番の 10 の位を設定します。				
		・"X1" は、局番の 1 の位を設定します。				
4	端子台	入力ユニ	ニット電渦	『、伝送、入出力信号の接続用端子		

台です。

\*1局番を重複して設定することはできません。

No.	<u>Item</u>	Description			
1	Operating	LED name	Confirmation details		
	status indicator	PW	Turns or is turned	when input module power supply on.	
i	LEDs	L RUN	Check if the input module is communicating with the master station normally. Turns on when normal data is received from master station, and turns off when time is expired. (Turned on by receiving normal data.)		
		SD	Turns on when sending data.		
		RD	Turns on when receiving data.		
		L ERR.	Turns on when transmission error (CRC error) occurred, and turns off when time is expired. (RUN also turns off.) Turns on when station number setting or transmission speed setting is incorrect (turns off when the setting is corrected and power is restarted). ERR flashes when station number setting or transmission speed setting is changed since startup. (RUN remains on. The module keeps operating with the same station number and transmission speed settings when the power was turned on.) Shows on/off status of I/O. Turns on when		
		on, turns off when off.			
2	Trans-	s	etting	Transmission speed	
	mission		0	156 kbps	
	speed		1	625 kbps	
	setting		2	2.5 Mbps	
			3	5 Mbps	
			4	10 Mbps	
		Be sure to set the transmission speed setting switches within the range of 0 to 4.			
3	Station number setting switches	Be sure to set the station numbers of remote I/O module within the range of 01 to 64. (* 1)  "X10" sets the tens digit of the station number.  "X1" sets the units digit of the station number.			
4	Terminal block	A terminal block for connection to the input module power supply, transmission and I/O signals.			
* 1 Duplicate station number cannot be set.					

Description

\* 1 Duplicate station number cannot be set.

# MITSUBISHI ELECTRIC CORPORATION HEAD OFFICE: MITSUBISH DENI BLOG MATAQUOM TONO 100-8510 TELEX: 20032 CHBLE MELOCITONO M.

B番号 IB-68718-E IBNO WAS AJ65BTB2-16D-U-HW

# AJ65BTB2-16D 形 CC-Link システムリモート入力ユニットユーザーズマニュアル AJ65BTB2-16D CC-Link System Remote Input Module User's Manual

### ● 安全上のご注意 ●

(ご使用前に必ずお読みください)

本製品のご使用に際しては、本マニュアルをよくお読みいただくと共に、安全に対して十分に注意を払って、正しい取扱いをしていただくようお願いいたします。

なお、この注意事項は本製品に関するもののみについて記載したものです。シーケンサシステムとしての安全上のご注意に関しては、CPU ユニットのユーザーズマニュアルを参照してください。この●安全上のご注意●では、安全注意事項のランクを「危険」、「注意」として区分してあります。

# **!** 危 険

取扱いを誤った場合に、危険な状況が起こりえて、死亡または重傷を受ける可能性が 想定される場合。



取扱いを誤った場合に、危険な状況が起こ りえて、中程度の傷害や軽傷を受ける可能 性が想定される場合および物的損害だけの 発生が想定される場合。

なお、<u>↑</u> 注意に記載した事項でも、状況によっては重大な結果に結びつく可能性があります。

いずれも重要な内容を記載していますので必ず守ってください。 本マニュアルは必要なときに読めるように大切に保管すると共 に、必ず最終ユーザまでお届けいただくようにお願いいたします。

#### 【設計上の注意事項】

### ① 危 険

- ●データリンクが交信異常になったとき、交信異常局は次のような状態になります。 ます。 少信状態情報を使って、システムが安全側に働くようにシーケンスプログラム上でインタロック回路を構成してください。 誤出力、誘動作により事故の恐れがあります。
- 設面力、設動作により争放の恐れがあります。 リモート 1/0 局からの入力は、全点 0FF します。
- リモート J/O ユニットの放酵によっては、入力が ON 状態または OFF 状態に なることがあります。重大な事故につながるような入力信号については、外 部で監視する回路を設けてください。

# ▲注意

- ユニットは、CPU ユニットユーザーズマニュアル記載の一般仕様の環境で使用してください。 一般仕様の範囲以外の環境で使用すると、感電、火災、誤動作、製品の損傷あるいは多代の原因になります。
- 制御線や通信ケーブルは、主回路や動力線などと束線したり、近接したりしないでください。100mm以上を目安として難してください。 フイズにより、譲動作の原因になります。

### 【取付け上の注意事項】

## ▲注 意

- ユニットの導電部分には直接触らないでください。 ユニットの誤動作、故障の原因になります。
- ユニットは、DIN レールまたは取付けネジにて、確実に固定し、取付けネジは規定トルク範囲内で確実に締め付けてください。 ネジの給付けがゆるいと、落下、短絡、誤動作の原因になります。 ネジを締め過ぎると、ネジの破損による落下、短絡の原因になります。

#### 【配線上の注意事項】

### **心危険**

- 配線作業などは、必ずシステムで使用している外部供給電源を全相遮断して から行ってください。全相遮断しないと、感電あるいは製品の損傷の恐れが あります。
- 取付け、配線作業などの後、通電、運転を行う場合は、必ず製品に付属の端子がバーを閉めてください。 端子がバーを閉めてください。

本マニュアルは再生紙を使用しています。

#### ■ SAFETY PRECAUTIONS ●

(Read these precautions before using.)


When using this equipment, thoroughly read this manual. Also pay careful attention to safety and handle the module properly.

These precautions apply only to this equipment. Refer to the CPU module user's manual for a description of the PLC system safety precautions.

These ■ SAFETY PRECAUTIONS ■ classify the safety precautions into two categories: "DANGER" and "CAUTION".



Procedures which may lead to a dangerous condition and cause death or serious injury if not carried out properly.

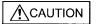

Procedures which may lead to a dangerous condition and cause superficial to medium injury, or physical damage only, if not carried out properly.

Depending on circumstances, procedures indicated by A CAUTION may also result in to serious results.

In any case, it is important to follow the directions for usage.

Store this manual in a safe place so that you can take it out and read it whenever necessary. Always forward it to the end user.

(0608) MEE

### [DESIGN PRECAUTIONS]

### (!)DANGER

- When a communication error occurs in the data link, the communication error station will be in the following condition. Configure an interlocking circuit in a sequence program using the communication status information so that the safety of the overall system is always maintained. Accident may occur due to output error or malfunction.
  - Input points from remote I/O station will be all off.
- Input could be on or off when there is trouble in the remote I/O modules. So build an external monitoring circuit that will monitor any input signals that could cause serious trouble.

# **ACAUTION**

- Use each module in an environment as specified in the "general specification" in the CPU module user's manual. Usage of the module outside the general specification range may cause electric shock, fire, malfunction, product damage or deterioration.
- Do not have control cables and communication cables bundled with or placed near by the main circuit and/or power cables. When those cables at least 100mm(3.94 inch) away from the main circuit and/or power cables. It may cause malfunction due to noise interference.

#### [INSTALLATION PRECAUTIONS]

# **∴**CAUTION

- Do not directly touch the module's conductive parts.
- Doing so could cause malfunction or trouble in the module.
- Tighten the module securely using DIN rail or installation screws within the specified torque range. Loose terminal screws may cause a short circuit or emoneous operation. If the terminal screws are too tight, it may cause falling, short circuit or erroneous operation due to damage of the screws.

#### [WIRING PRECAUTIONS]

# DANGER

- Completely turn off the externally supplied power used in the system when installing or placing wining. Not completely turning off all power could result in electric shock or damage to the product.
- Make sure to close the terminal cover shipped with the product when starting the power supply or operation after installation, wiring, etc. If terminal cover is not closed an electric shock may result.

Printed in Japan on recycled paper.

### ∧注 意

- FG 端子はシーケンサ専用の D 種接地 (第三種接地) 以上で必ず接地を行ってください。感電、誤動作の恐れがあります。
- 空き端子ネジは必ず締付けトルク範囲(42~50N·cm)で締付けてください。 圧着端子と短絡する原因になります。
- ● 圧着端子は適合圧着端子を使用し、規定のトルクで締付けてください。 年開那圧着端子を使用すると、端子ネジがゆるんだ場合に脱落し、故障の原 別になります。
- ユニットの配線は、製品の定格電圧および端子配列を確認した上で正しく行ってください。
   定格と異なった電源を接続したり、誤配線すると、火災、故障の原因になり
- 端子ネジの締付けは、規定トルク範囲内で行ってください。端子ネジの締付けがゆるいと、火災や誤動作の原因になります。
- 端子ネジを締め過ぎると、ネジの破損による短絡、誤動作の原因になります。 ■ ユニット内に、切粉や配線クズなどの異物が入らないように注意してください。 火災、故腔、誤動作の原因になります。
- ユニットに接続する電線やケーブルは、必ずダクトに納める。またはクランプによる固定処理を行ってください。 ケーブルをダクトに納めなかったり、クランプによる固定処理をしていないと、ケーブルのふらつきや移動、不注意の引っ張りなどによるユニットやケーケーブルのふらつきや移動、不注意の引っ張りなどによるユニットやケーケーブルのふらつきである。
- ーブルの破損、ケーブルの接触不良による誤動作の原因となります。 ● 制御線と通信ケーブルは束線したり、近接したりしないでください。
- ノイズにより、誤動作の原因になります。

   ユニットに接続された通信ケーブルや電源ケーブルを取り外すときは、ケーブル部分を手に持って引っ張らないでください。
- コネクタ付きのケーブルは、ユニットに接続している部分のコネクタを手で 持って取り外してください。コネクタなしのケーブルは、ユニットに接続し ている部分のネジを緩めてから取り外してください。 ユニットに接続された状態でケーブルを引っ張ると、ユニットやケーブルの 破損、ケーブルの接続不良による誤動作の原因となります。

#### 【立上げ・保守時の注意事項】

# ①危 険

- 通電中に端子に触れないでください。感電の原因になります。
- 清掃、端子ネジ、ユニット取付けネジの増し締めは、必ずシステムで使用している外部供給電源を全相遮断してから行ってください。全相遮断しなしと、ユニットの故障や誤動作の原因になります。

# 

- ユニットの分解、改造はしないでください。故障、誤動作、ケガ、火災の原因になります。
- ユニットは落下させたり、強い衝撃を与えないでください。 ユニットの破損の原因になります。
- ユニットの壁への取付け・取外しは必ずシステムで使用している外部供給電源を全相遮断してから行ってください。全相遮断しないと、ユニットの故障や陰動性の原因になります。
- 端子台の着脱は、製品ご使用後、50回以内としてください。 (JIS B 3502 準拠)
- ユニットに触れる前には、必ず接地された金属などに触れて、人体などに帯電している静電気を放電してください。

## **静電気を放電しないと、ユニットの故障や誤動作の原因になります。**

### 【廃棄時の注意事項】

# ▲注 意

● 製品を廃棄するときは、産業廃棄物として扱ってください。

#### 1 什样

1. 江休				
項目		内容		
入力点数		16点		
絶縁方式		フォトカプラ絶縁		
定格入力電圧		DC24V		
定格入力電流		約7mA		
使用電圧範囲		DC19.2~28.8V (リップル率 5%以内)		
最大同時入力点数		100%		
ON電圧/ON電流		14V以上/3.5mA以上		
OFF 電圧/ OFF 電流		6V以下/1.7mA以下		
入力抵抗		約3.3kΩ		
応答時間	OFF → ON	10msec 以下		
	ON → OFF	10msec 以下		

### **ACAUTION**

- Always ground the FG terminal.

  There is a risk of electric shock or malfunction.
- Be sure to tighten any unused terminal screws within a tightening torque range (42 to 50N cm).
- Failure to do so may cause a short circuit due to contact with a solderless terminal.

   Use applicable solderless terminals and tighten them with the specified
- torque.
  If any solderless spade terminal is used, it may be disconnected when the
- terminal screw comes loose, resulting in failure.

  Perform correct wining for the module according to the product's rated voltage cand terminal arrangement. Connecting to a power supply different
- from rating or miss-wiring may cause fire and/or product failure.

  Fix terminal screws securely within the regulated torque. Loose terminal screws may cause fire and/or malfunction.
- If the terminal screws are too tight, it may cause short circuit or erroneous operation due to damage of the screws.
- Make sure foreign objects do not get inside the module, such as dirt and wire chips. It may cause fire, product failure or malfunction.
- Be sure to fix the wires or cables by ducts or clamps when connecting them
  to the module. Failure to do so may cause damage of the module or the
  cables due to accidental pull or unintentional shifting of the cables, or
  malfunctions due to poor contact of the cable.
- Do not install the control lines together with the communication cables, or bring them close to each other. Failure to do so may cause malfunctions due to noise.
- When disconnecting a communication or power supply cable from the module, do not pull on the cable itself. Disconnect cables not fitted with a connectors by holding and pulling the cable connector. Disconnect cables not fitted with a connector by removing the screws from the part connected to the module can cause damage to the module or cable, or malfunction due to cable connection faults.

#### **[STARTING AND MAINTENANCE PRECAUTIONS]**

# **DANGER**

- Do not touch terminals when the power is on. Doing so could cause an electric shock.
- Switch off all phases of the externally supplied power used in the system when cleaning the module or retightening the terminal or module mounting screws. Not doing so could result in electric shock.

# **∴** CAUTION

- Never try to disassemble of modify module. It may cause product failure, malfunction, fire or cause injury.
- Do not drop or apply any strong impact to the module. Doing so may damage the module.
- Completely turn off the externally supplied power used in the system before mounting or removing the module to/from the panel. Not doing so could result in damage to the product.
- Mounting/removing the terminal block is limited to 50 times after using a product. (IEC61131-2-compliant)
- Always make sure to touch the grounded metal to discharge the electricity charged in the electricity charged in the body, etc., before touching the module.
- Failure to do so may cause a failure or malfunctions of the module.

#### [DISPOSAL PRECAUTIONS]

# **∴**CAUTION

When disposing of this product, treat it as industrial waste.


#### 1. Specification

Item		Description	
Number of Input points		16 points	
Isolation method		Photocoupler	
Rated input voltage		24 VDC	
Rated input current		Approx. 7 mA	
Operating voltage range		19.2 to 28.8 VDC (ripple ratio: within 5%)	
Max. simultaneous ON input points		100 %	
ON voltage/ON current 14 V or higher/3.5 mA or higher		14 V or higher/3.5 mA or higher	
OFF voltage/OFF curren		6 V or lower/1.7 mA or lower	
Input resistance		Approx. 3.3 kΩ	
Response	OFF → ON	10 msec or lower	
time	ON → OFF	10 msec or lower	

項目		内容
コモン方式		16点1コモン
		(2 線式端子台)
入力形式		シンク,ソース共用タイプ
占有局数		1局
I/O ユニット電源	電圧	DC15.6~28.8V(リップル率 5%以内)
	電流	60mA以下(TYP.DC24V 時)
ノイズ耐量		DC タイプのノイズ電圧 500Vp-p
		ノイズ幅 1μs, ノイズ周波数 25~60Hz の
		ノイズシミュレータによ <u>る</u>
耐電圧		DC 外部端子一括
		アース間 AC500V 1 分間
絶縁抵抗		DC 外部端子一括 アース間 DC500V
	_	絶縁抵抗計にて10MΩ以上
質量		400g
外部接続方式		37点端子台
		(M3.5ネジ締付けトルク59~88N·cm)
		伝送回路,
		ユニット電源端子含む
適合電線サイズ		0.75~2mm²
ユニット取付けネ	ジ	M4×0.7mm×16mm 以上ネジ
		(締付けトルク範囲 78~118N·cm)
		DIN レールでの取付けも可能
適用 DIN レール		TH35-7.5Fe, TH35-7.5AI, TH35-15Fe
		(JIS C 2812 に準拠)
適合圧着端子		RAV 1.25-3.5 (JIS C 2805 に準拠)
		RAV 2-3.5

ltem		Description		
Common method		Description 16 points/common		
Common method		(2-wire terminal block)		
Input form		Sink/source loading shared type		
Number of stations	occupied	1 station		
I/O module	Voltage	15.6 to 28.8 VDC (ripple ratio : within 5 %)		
power supply	Current	60 mA or lower (when TYP.24 VDC)		
Noise durability		DC type noise voltage 500Vp-p, Noise width 1µs, Noise frequency 25 to 60Hz (noise simulator condition)		
Withstanding voltage		500 VAC for 1 minute between all DC external terminals together and ground		
Insulation resistance		10 MΩ or higher, measured with a 500 VDC insulation resistance tester		
Weight		400 g (0.9 lb)		
External wiring system		37-point terminal block (M3.5 screws tightening torque: 59 to 88 N·cm) including transmission circuit, and module power supply terminal		
Applicable wire size		0.75 to 2 mm <sup>2</sup>		
Module installation screw		M4 (0.16) × 0.7 mm (0.03) × 16 mm (0.63) screws (tightening torque range 78 to 118 N·cm) DIN rails can be used for installation		
Applicable DIN rail		TH35-7.5Fe, TH35-7.5AI, TH35-15Fe (conforming to IEC 60715)		
Applicable solderless terminal		RAV 1.25-3.5 (JIS C 2805 conforming) RAV 2-3.5		
		· · · · · · · · · · · · · · · · · · ·		



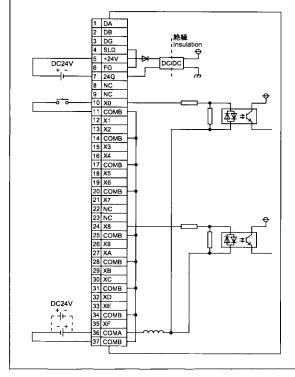

端子番号	端子番号 信号名		信号名
Terminal number	Signal name	Terminal number	Signal name
TB1	DA	TB20	COMB
TB2	DB	TB21	X7
TB3	DG	TB22	NC
TB4	SLD	TB23	NC
TB5	+24V	TB24	X8
TB6	₼FG	TB25	COMB
ТВ7	24G	TB26	Х9
TB8	NC	TB27	XA
TB9	NC	TB28	COMB
TB10	X0	TB29	ХВ
TB11	COMB	TB30	XC
TB12	X1	TB31	COMB
TB13	X2	TB32	XD
TB14	COMB	TB33	XE
TB15	Х3	TB34	COMB
TB16	X4	TB35	XF
TB17	COMB	TB36	COMA
TB18	X5	TB37	COMB
TB19	X6		